

MID TUBE ONLY — SHIP JULY 29th

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM



Page 1

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/22/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D3391

Rev H

100

0.00



Skidtubes

Skidtubes

0.00

Skidtubes

Memo

1-Cut tube to finish length as per Dwg D3391

2-Identify as D3391-023

3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391

6-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

7-Deburr

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker.

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J", do not open wearplate holes of section "J"

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

B

11/07/26

P.T.O.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D2391-023 PAR #: HP Fault Category: Skid tube, Landing gear NCR: (Yes) No DQA: ✓ Date: 11.08.09
 Resolution: Acceptable as is Disposition: As is QA: N/C Closed Date: 11/08/10

NCR: <u>72318</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
<u>11/07/26</u>	<u>100</u>	<u>(2) DRILLED TWO FORWARD WEAR PLATE HOLE. 297 IN SHOULD BE .250</u>	<u>[Signature]</u> <u>09542</u> <u>4.2.10</u>	<u>Acceptable deviation</u>	<u>[Signature]</u> <u>11/07/26</u>	<u>S</u> <u>11/07/29</u>	<u>[Signature]</u> <u>09542</u> <u>4.2.10</u>	<u>[Signature]</u> <u>11.07.26</u>

NOTE: Date & initial all entries

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM



Page 2

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/22/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

11-Open .375" holes to .438" ***do not open fwd saddle holes***

BB

u/07/26

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allignment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

N/A

15- Locating from two fwd wearplate holes drill remaining 6 wearplate holes in D3391-021 using DT8937

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open 12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM

Page 3

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Start Date: 7/22/2011 Start Qty: 1.00

Required Date: 7/29/2011 Req'd Qty: 1.00

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start

QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID Tool # Plan Code Accept Qty Reject Qty Reject Number Insp. Stamp

110

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

Handwritten: 11 07 26 (J)

120

Chemical Conversion Coat per QSI005 4.1

0.00



HandFinish

Memo

0.00

Hand Finishing

Handwritten: 1 8 8E110727

130

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

Handwritten: 11-7-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM

Page 4

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Start Date: 7/22/2011 Start Qty: 1.00

Required Date: 7/29/2011 Req'd Qty: 1.00

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start

QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

140

0.00



Skidtubes

Skidtubes

Memo

0.00

1-Open float bag holes as per dwg
2-C'sink float bag holes as per dwg
3- Prepare tube for welding
4-Bond web in place as per Dwg D3391 & QSI 015.
Adhere for 12 hours)
A/R Sikaflex exp: 47546 12/01/15
batch#: 117546

150

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

160

0.00



Skidtubes

Skidtubes

Memo

0.00

1-Weld crossbolt spacer as per dwg D3391 & QSI 004
2-grind weld flush

A/R M115778

x/

DL
11/07/27

/ 0 BB 10/28

/ J BB 10/28

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM



Page 5

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/22/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop



QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID Tool # Plan Code Accept Qty Reject Qty Reject Number Insp. Stamp

170



QC

Quality Control

QC10- Inspect visual per QSI004- ground welds

0.00

Memo

0.00

11.0728

180



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00

11.0728(1)

185



HandFinish

Hand Finishing

Pressure Wash per QSI005 4.3

0.00

Memo

0.00

AND REALODINE AS PER PAR09-043

1. 11.0725

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM



Page 6

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/22/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan:

Date:

Tooling:

Date:

Stop



QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID Tool # Plan Code Accept Qty Reject Qty Reject Number Insp. Stamp

190

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00



Powdercoat

MU7745.

Memo

0.00

Powder Coating

START TIME: *1:00*
OVEN TEMPERATURE: *320°*
FINISH TIME: *1:30*

1 0 MU 11-7-08.

200

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

1 0 MU 11-07-08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM



Page 7

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/22/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan:

Date:

Tooling:

Date:

Stop



QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

210

0.00



Skidtubes

Skidtubes

Skidtubes

Memo

1- insert D3391-021 into D3391-23

2- insert T-pins into first and third fwd saddle holes

3- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364

4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos

5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499" Remove DT9415

6- deburr, re-alodine and blow out chips

7- press fit D3591-1 spacers using DT9416 starting from 0.500" side

220

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

install wezphotes

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM

Page 8

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Setup Start

Stop

Start Date: 7/22/2011 Start Qty: 1.00

Required Date: 7/29/2011 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID Tool # Plan Code Accept Qty Reject Qty Reject Number Insp. Stamp

230



HandFinish

Hand Finishing

HandFinishing

Memo

Install Inserts as per Dwg

0.00

0.00

1

4

Handwritten: 11/04/25

240



QC

Quality Control

QC5- Inspect part completeness to step on W/O

Memo

0.00

0.00

Handwritten: Smith

Handwritten: (tu)

250



Packaging

Packaging

Identify as per dwg & Stock Location:

Memo

Handwritten: ship

0.00

0.00

Handwritten signature: Puller

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72318

Friday, July 22, 2011 10:25:36 AM



Page 9

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/22/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan:

Date:

Tooling:

Date:

Stop



QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
---------	--------	--------------	---------------	---------------	------------------	----------------

260

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

W/7/29

W/11-07-29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Friday, July 22, 2011 10:25:33 AM

Page 1

Work Order ID: 72318

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 7/22/2011

Required Date: 7/29/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A 05.10.20 New Issue KJ/EC
 IPP B 06.02.10 ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev: I 08-11-13 Removed steps per w/o. QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-100

Manufactured

No

100

Each

78.0000

1

1



Skidtube Extrusion



①

③

Location

Loc Qty

Loc Code

HALL

78

37065

3

50251

75

D3391-021

Manufactured

No

100

Each

0.0000

1

1



Fwd Tube Assembly



D3389-1

Manufactured

No

140

Each

1.0000

1

1



Web



Location

Loc Qty

Loc Code

LG

23165

1

71333

1

DR.
11/02/27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Friday, July 22, 2011 10:25:33 AM

Page 2

Work Order ID: 72318

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 7/22/2011

Required Date: 7/29/2011

Start Qty: 1.00

Required Qty: 1.00

D3681-1 Manufactured No 160 Each 9.0000 5 5
Spacer

Location	Loc Qty	Loc Code
LG	9	
68958	2	
69893	7	

D3591-1 Manufactured No 210 Each 21.0000 2 2
Bushing

Location	Loc Qty	Loc Code
ST068	21	
57350	1	
66147	20	

ALS4-1032-130 Purchased No 230 Each 3,132.000 20 20
Insert

Location	Loc Qty	Loc Code
ST281	1008	
117331	8	
<u>118386</u>	1000	
ST282	2124	
117717	124	
118237	1744	
118312	256	

Handwritten: 8/20/07/28
B 71845 x5

Handwritten: 11/07/28

Handwritten: X20

Handwritten: PTO = 7

Friday, July 22, 2011 10:25:34 AM

Shop Packet Print

Page 2

Dart Aerospace Ltd


W/O: 72318		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
11/07/28	230	Assemble with: (1x) D3564-5 / B70864 washer plate (1x) D3566-5 / B68961 GASKET	SM	11/07/28	X1 X1	N/A	S 11/07/29
11/07/28	230	Also Assemble with: (12x) AN3C-4A / M117795 bolt (12x) NAS1149C0332R / M118306 washer	SM	11/07/28	X12 X12	N/A	S 11/07/29

Part No: D3391-023 PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

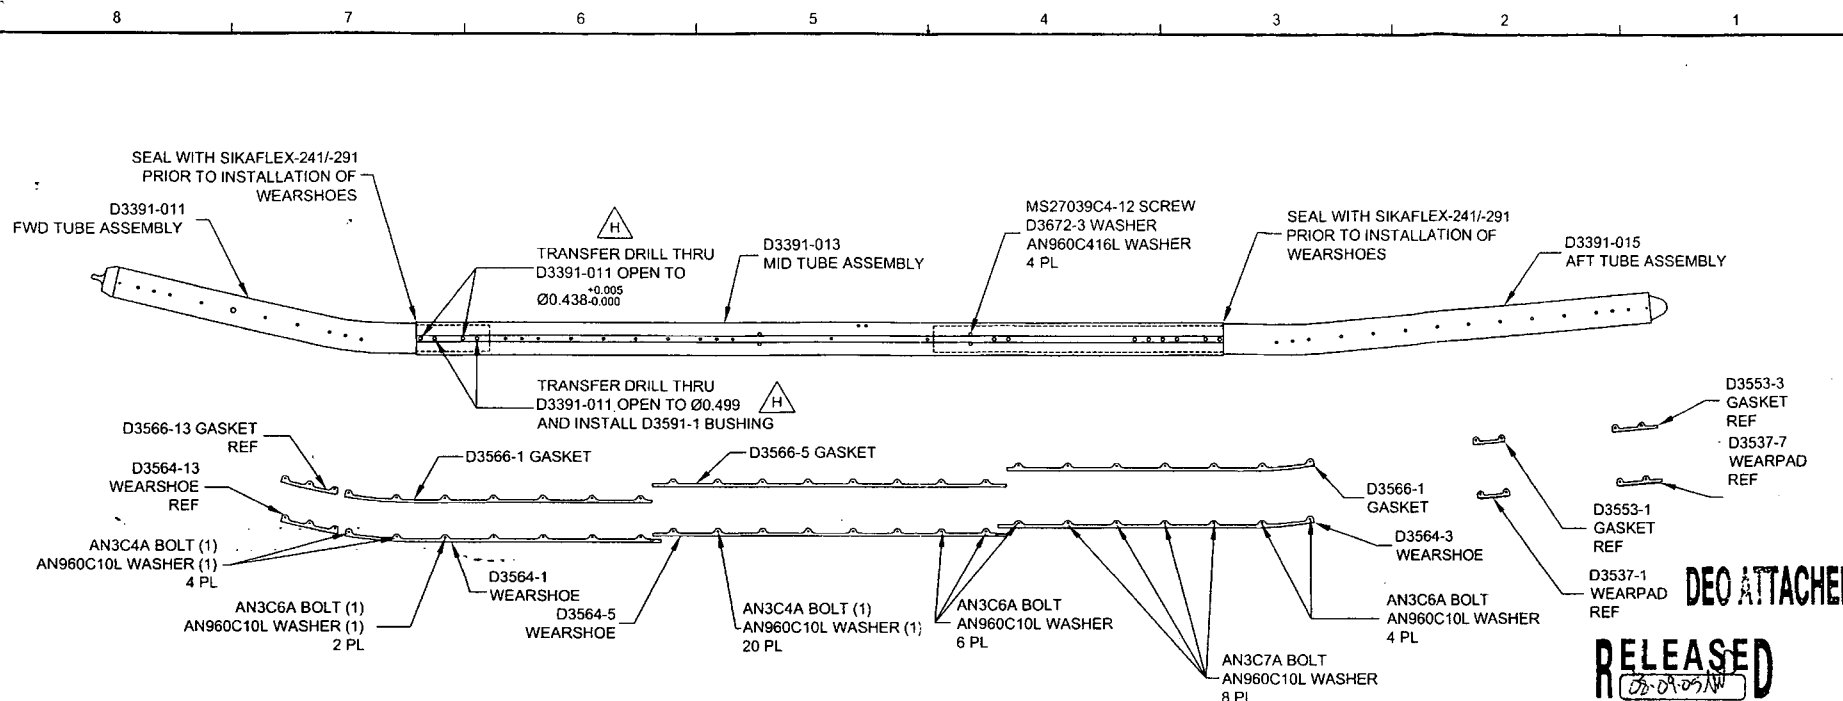

D3391-041 ASSEMBLY

DEO ATTACHED
RELEASED

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-5	GASKET
1	D3566-1	GASKET
2	D3566-13	GASKET
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C-BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.

H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

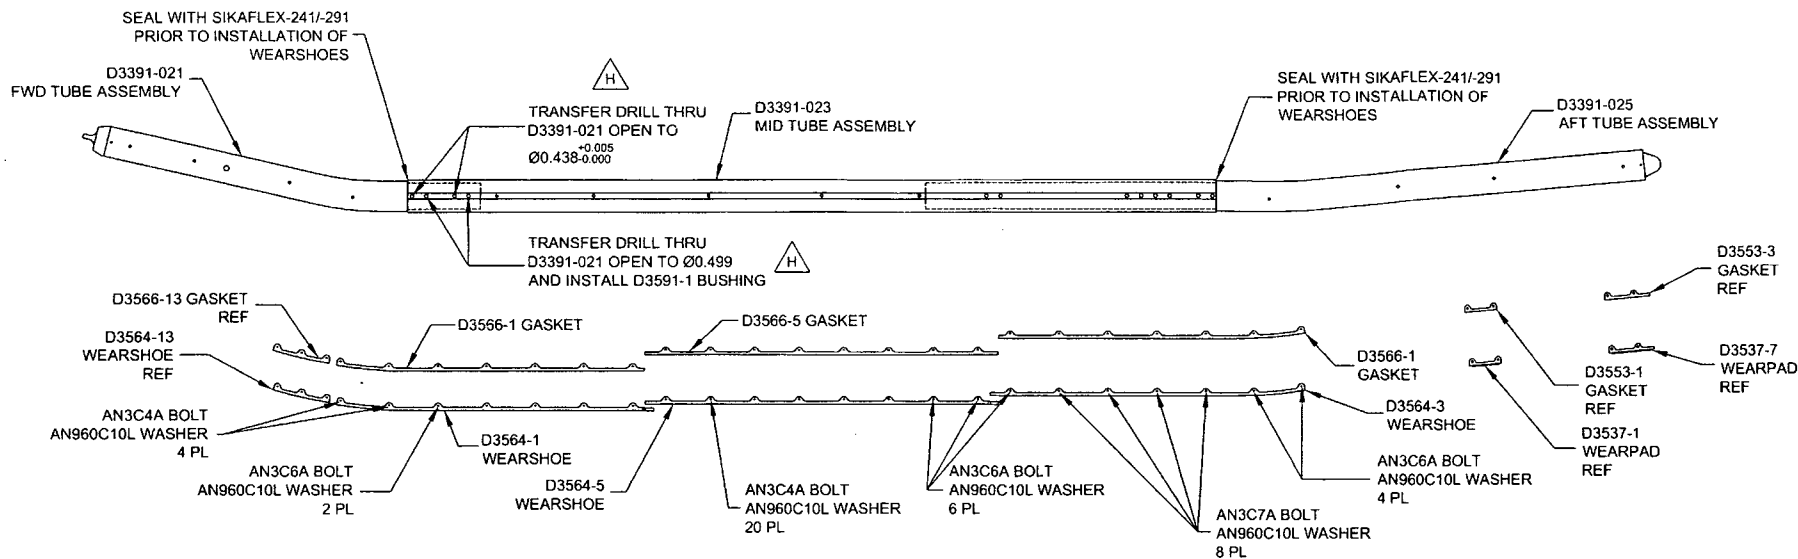

D3391-043 ASSEMBLY

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
24	AN3C4A	BOLT
12	AN3C6A	BOLT
6	AN3C7A	BOLT
44	AN960C10L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AUS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small> COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND CONFIDENTIAL AND IS SUPPLIED ON THE BASIS OF A CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. </small>	


DEO ATTACHED

RELEASED
08-09-25/10


12318

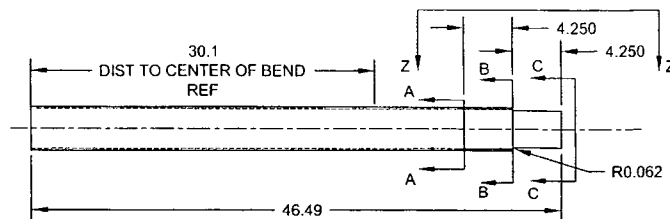


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

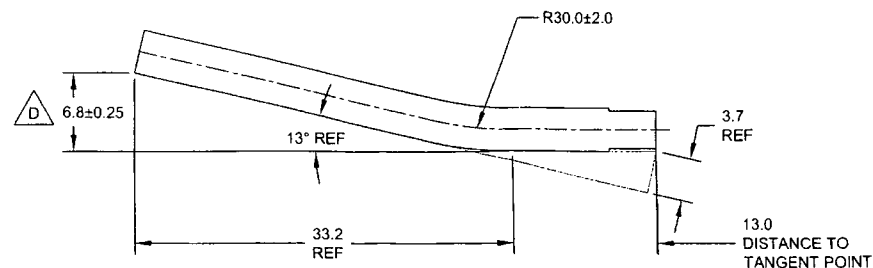


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

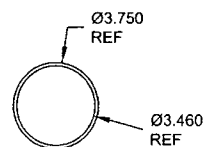


SECTION A-A
SCALE 2X

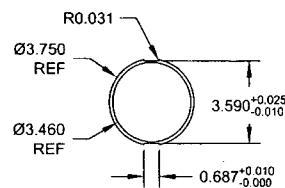

SECTION B-B
SCALE 2X

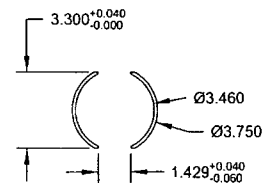

SECTION C-C
SCALE 2X

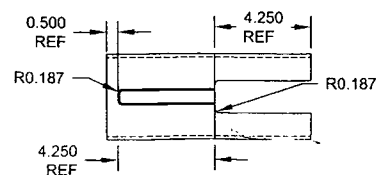


VIEW Z-Z
SCALE 2X








72318

DEO ATTACHED
RELEASED
08-05-10

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AUS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE BASIS OF A CONDITIONAL LICENSE NOT TO BE USED FOR ANY PURPOSE OR COPIED OR CONTAINED IN ANY OTHER MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC</small>	

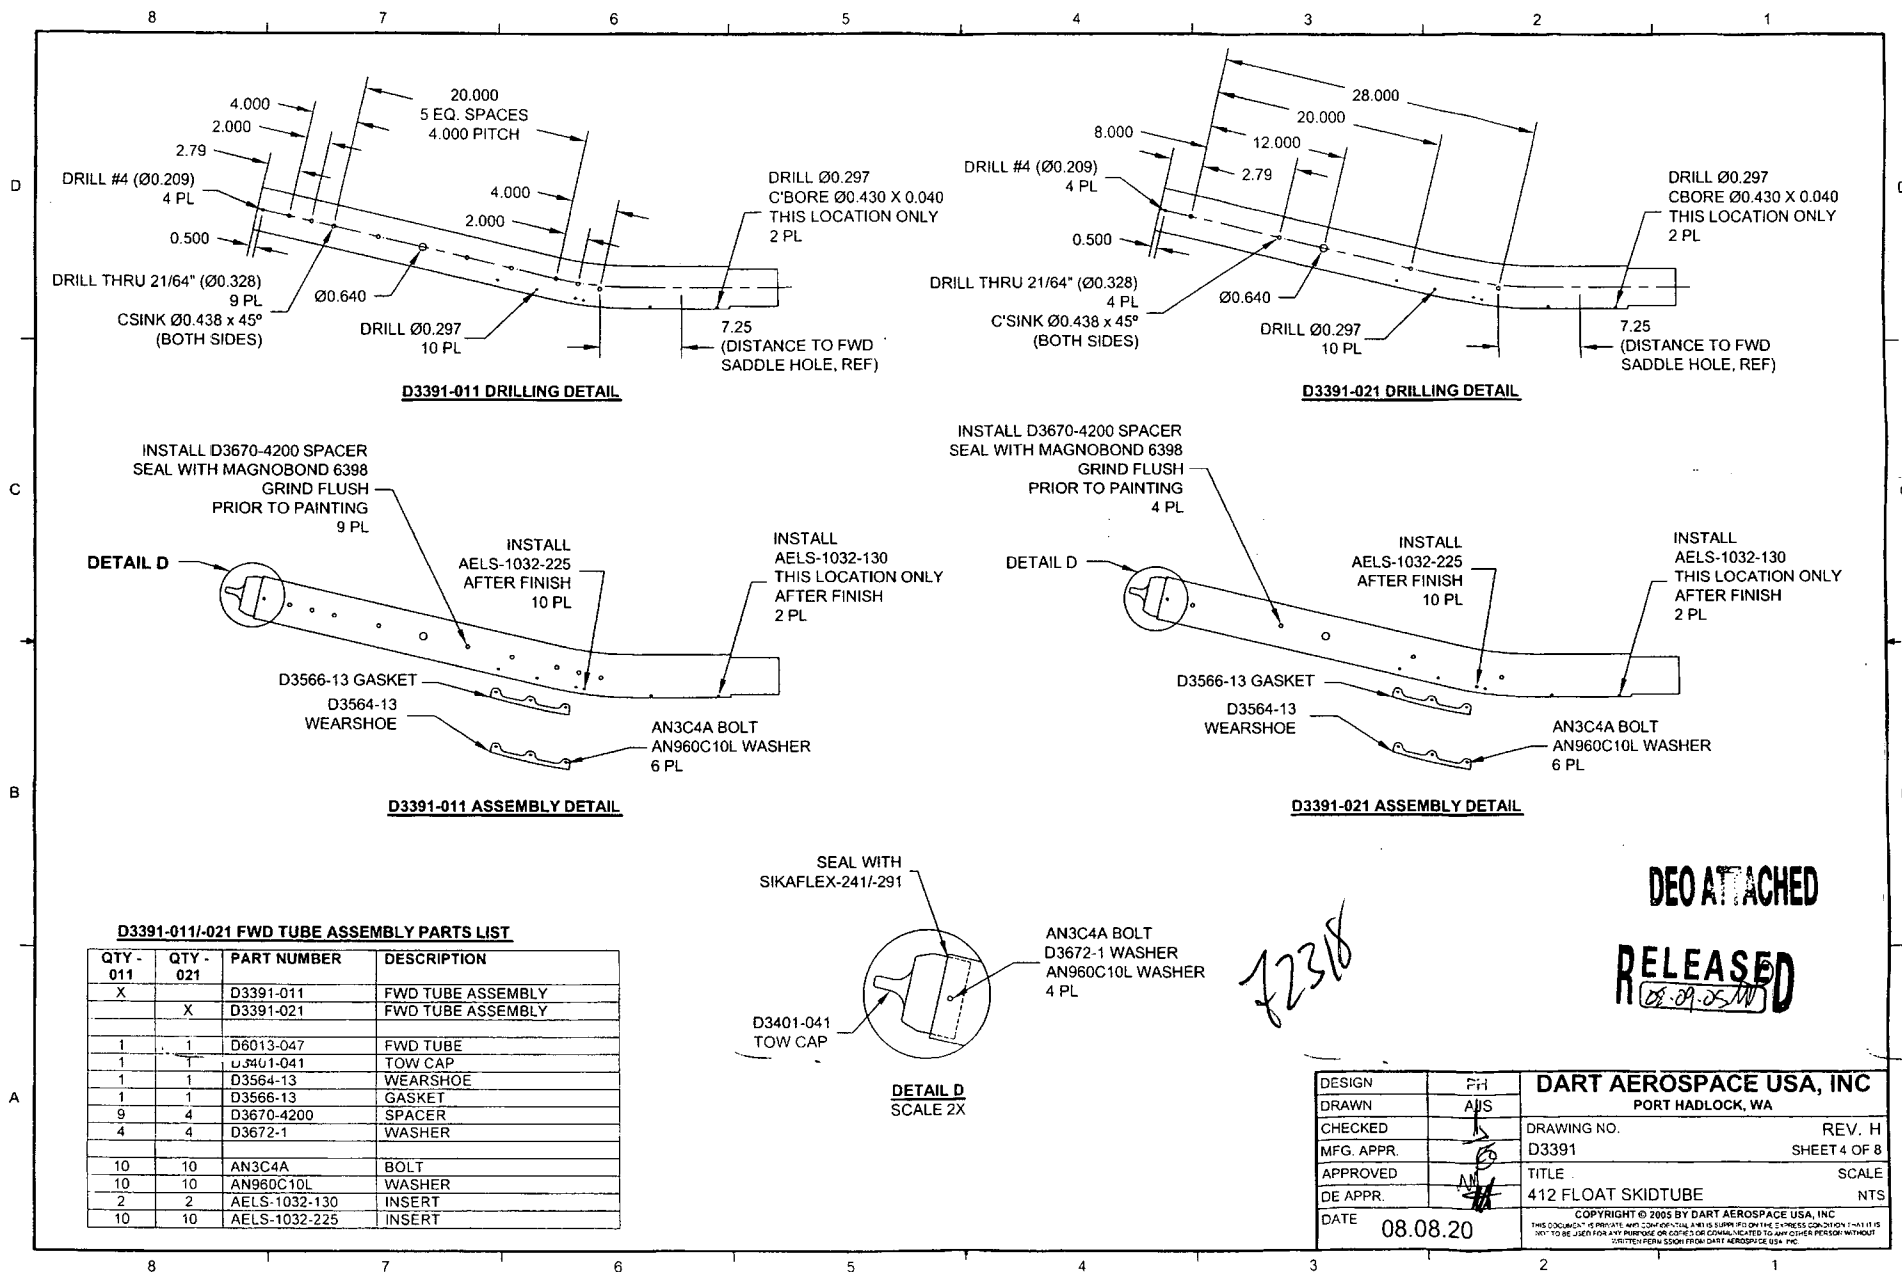

8 7 6 5 4 3 2 1

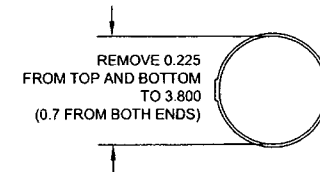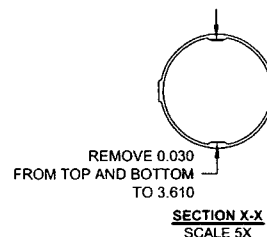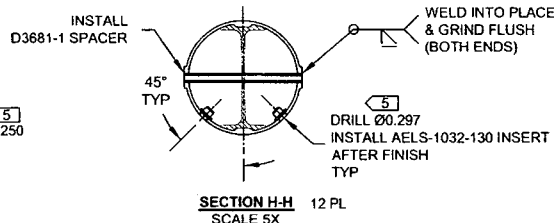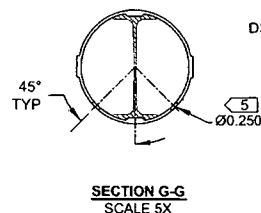
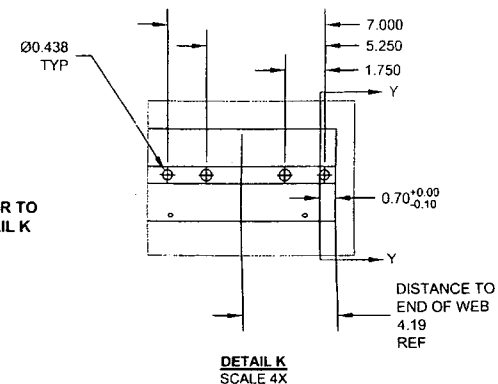
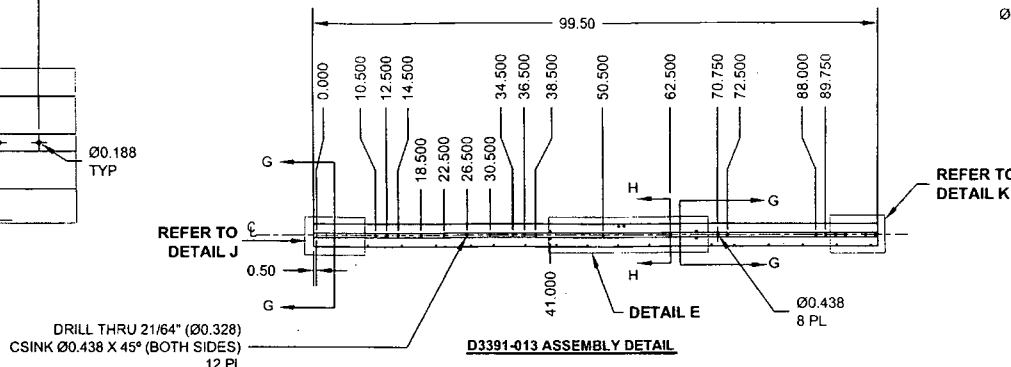
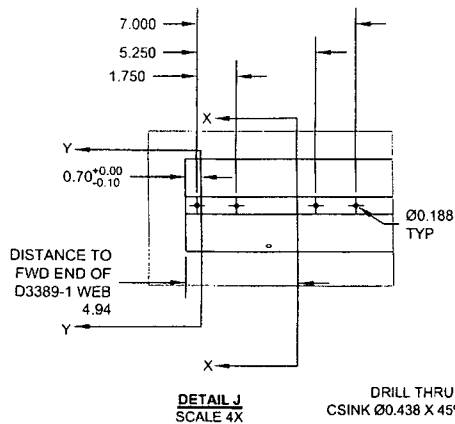


D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW


D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

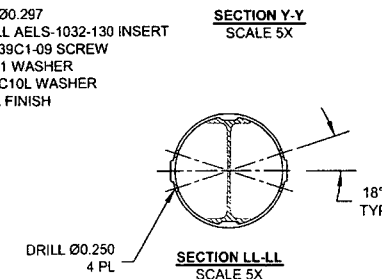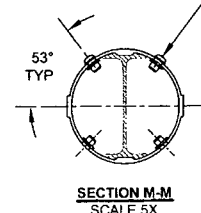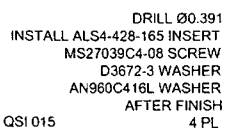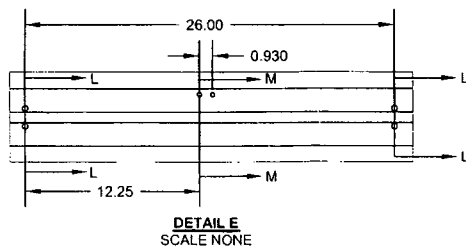


DEO ATTACHED RELEASED


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AS	PORT HADLOCK, WA	
CHECKED		DRAWING NO. D3391	REV. H
MFG. APPR.		SHEET 5 OF 8	
APPROVED		TITLE 412 FLOAT SKIDTUBE	SCALE NTS
DE APPR.		DATE 08.08.20	
<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC</small>			

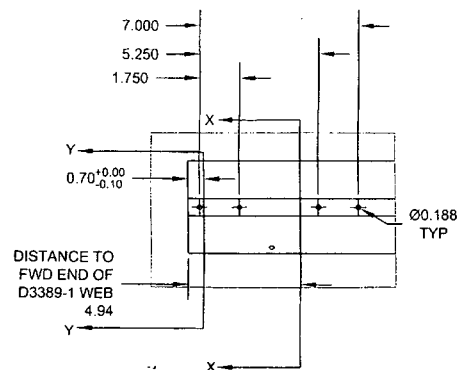


DETAIL J
SCALE 4X

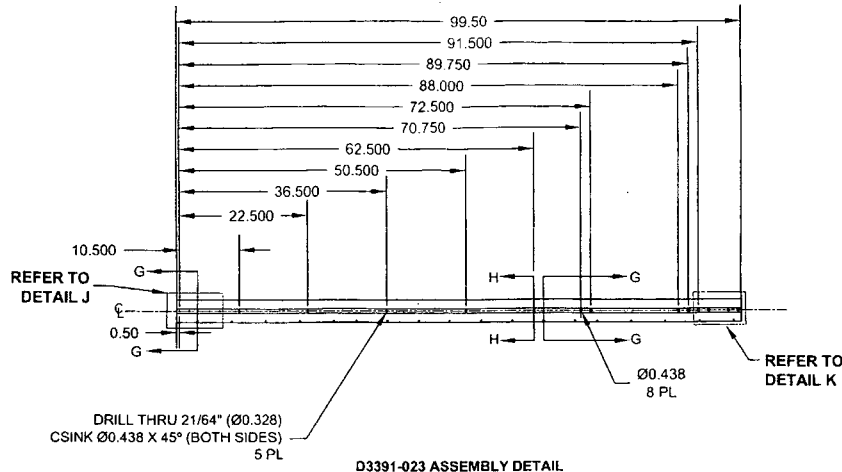


D3391-023 ASSEMBLY DETAIL

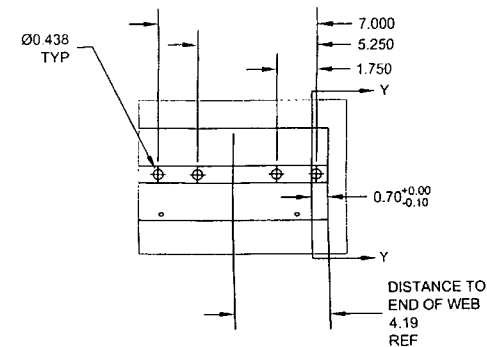


DETAIL K
SCALE 4X

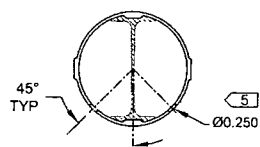


SECTION G-G
SCALE 5X

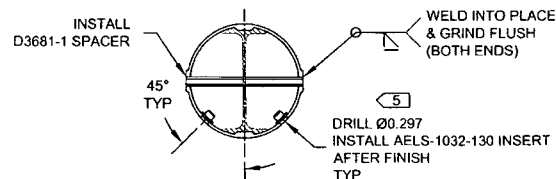

SECTION H-H
SCALE 5X

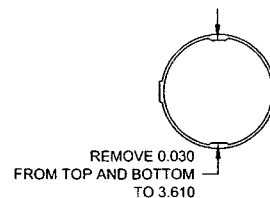

SECTION X-X
SCALE 5X

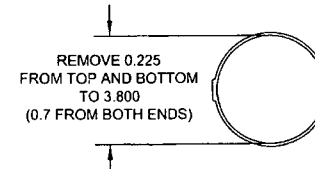

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT


D3391-023 MID TUBE ASSEMBLY


- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.</small> <small>THIS DOCUMENT IS UNCLASSIFIED AND CONTROLLED BY DART AEROSPACE USA, INC. IT IS NOT TO BE USED FOR ANY PURPOSE OR COMPLETED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

DEO ATTACHED
RELEASED
08-08-20


72318

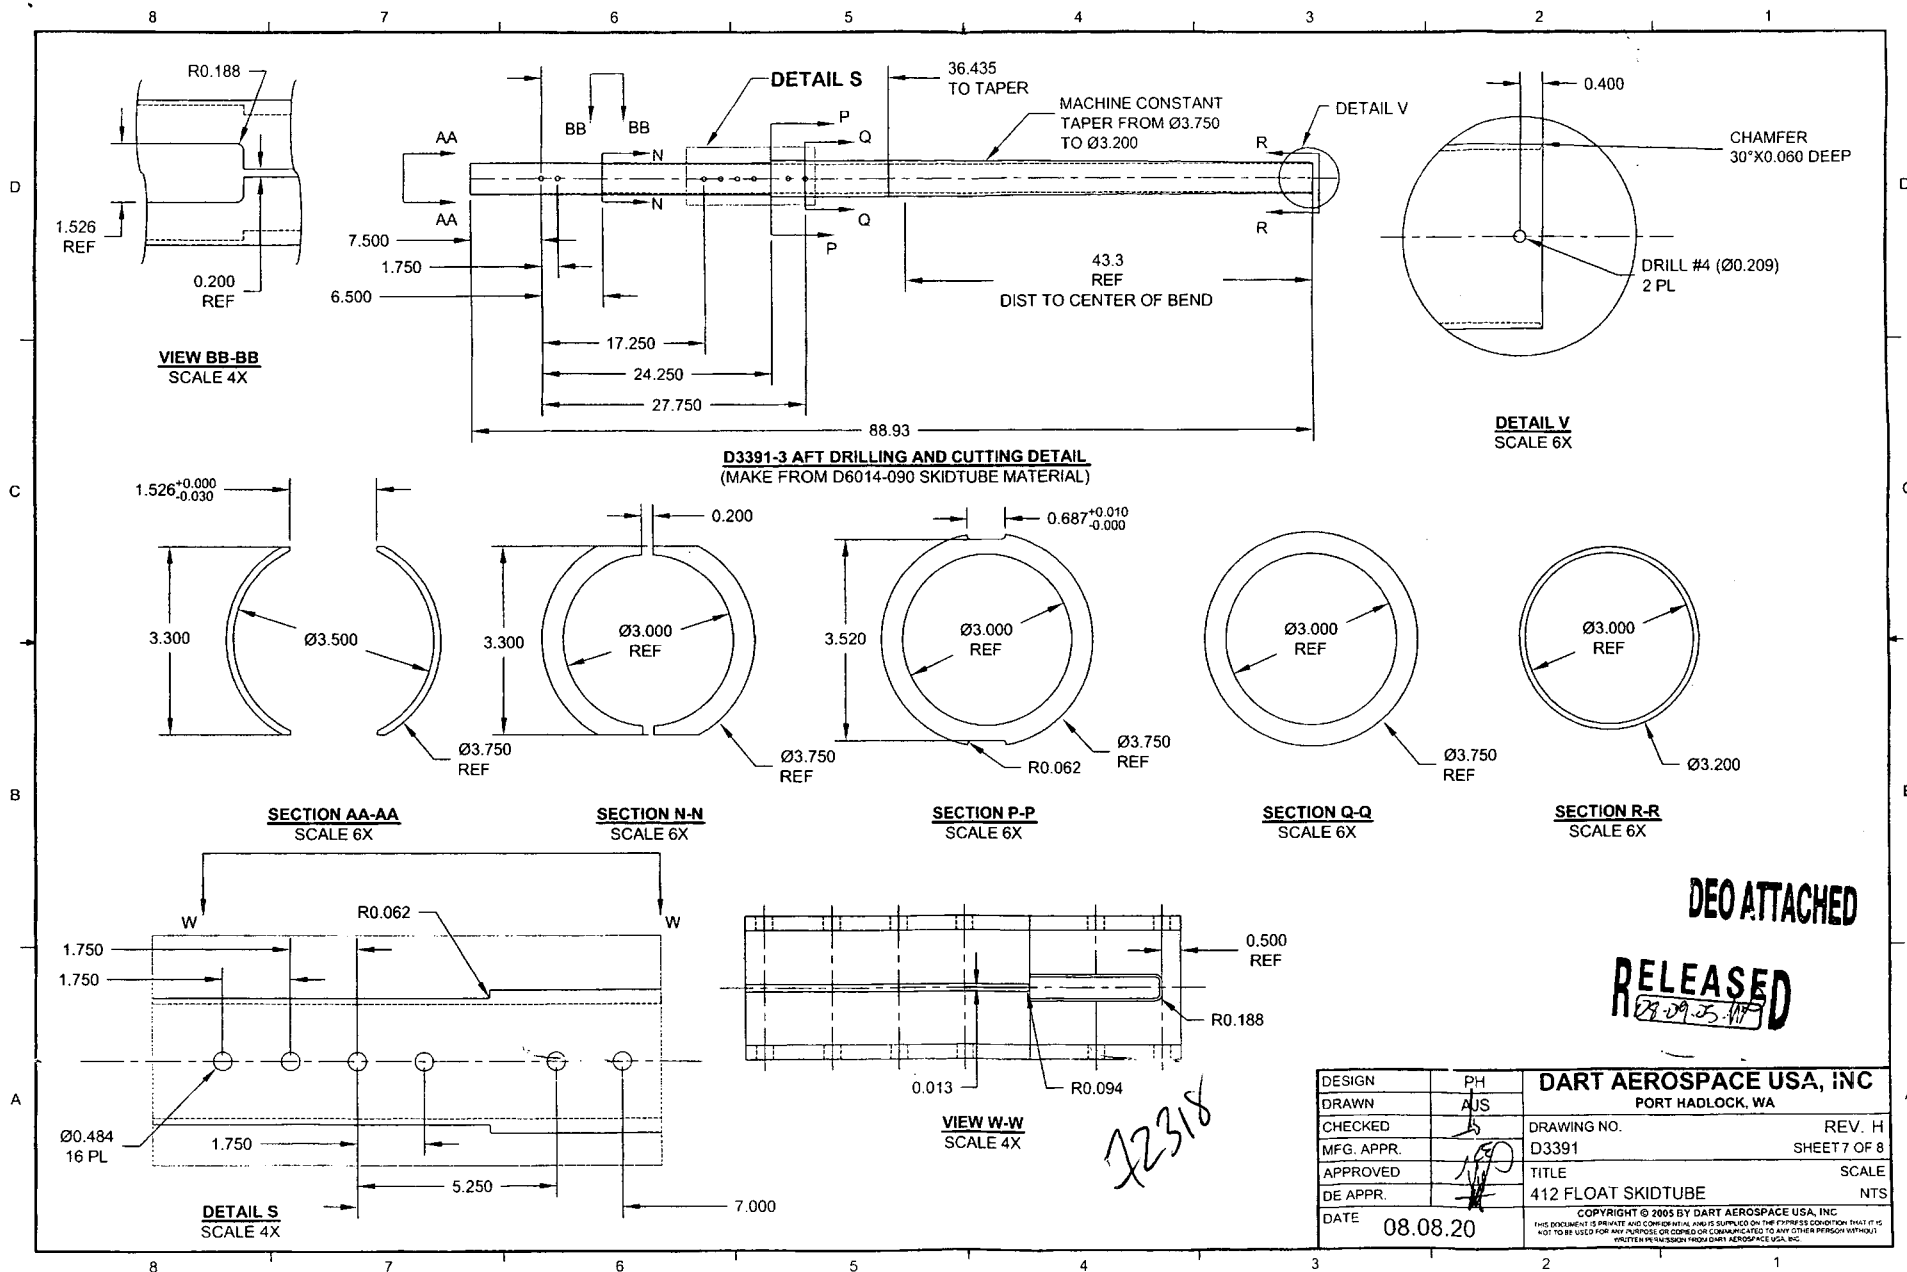

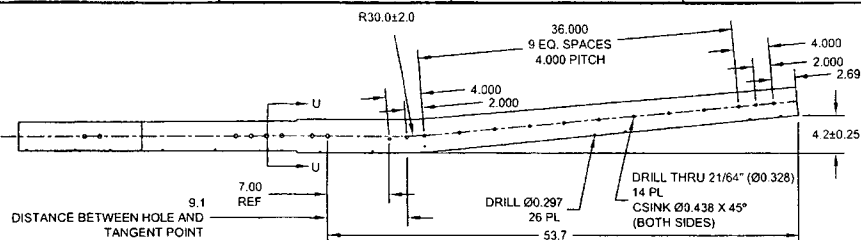

D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)


INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
14 PL

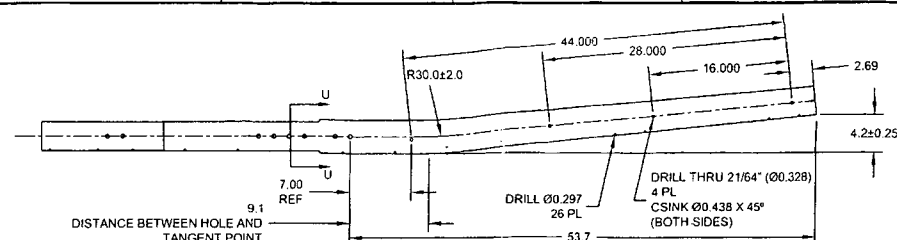


D3391-025 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
4 PL

D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

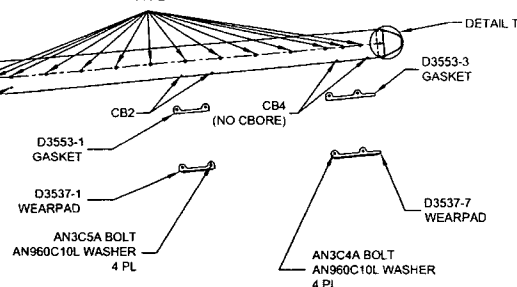


D3391-025 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

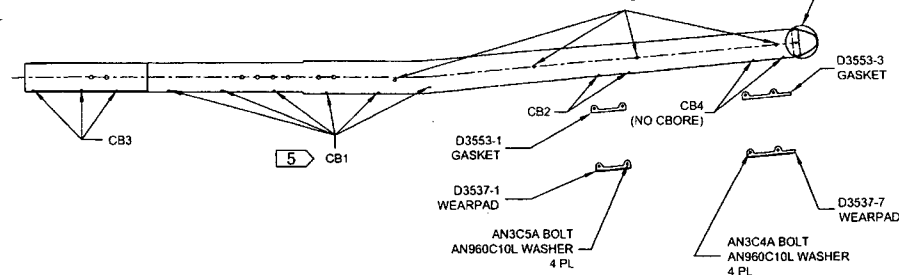


D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
X	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

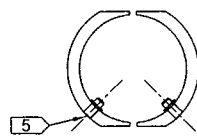


SECTION U-U
SCALE 3X

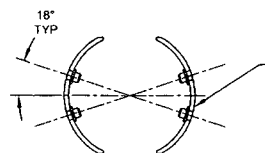

SECTION CC-CC
SCALE 3X

DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

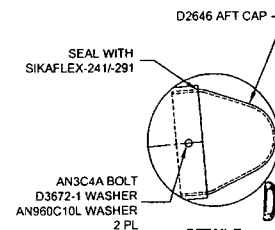

DETAIL T
SCALE 4X

DEO ATTACHED

RELEASED
08-09-05-147

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED	h	DRAWING NO.	REV. H
MFG. APPR.	B	D3391	SHEET 8 OF 8
APPROVED	B	TITLE	SCALE
DE APPR.	B	412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

DRAWING NO. D3391	TITLE 412 FLOAT SKIDTUBE	REV. H	DART AEROSPACE USA, INC ENGINEERING ORDER		D.E.O. NO. D3391-H-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>MP</i>	CHECKED <i>h</i>	MFG. APPR. <i>MA</i>	APPROVED <i>MP</i>		DE APPR. <i>h</i>		
DATE 09.09.23	DATE 04.09.24	DATE 09/09/25	DATE 09/09/30		DATE 09/09/30		

PURPOSE:

LPS-3 IS NO LONGER USED DURING ASSEMBLY OF D3391-041/-043 SKIDTUBES.

CHANGE:

AMEND NOTE 2 OF D3391-041/-043 SKIDTUBE ASSEMBLIES (ZN A6-1, A6-2) AS FOLLOWS:

- 2) ~~SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH~~
~~AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH~~
 LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
 OFF POWDER COATING WITH MEK DEGREASER.

RELEASED
 2010-02-02
MP

7238

NO. 256

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliot
Job number: B 70180
Part number: D3391-023
Description: Mid Tube
Welding Process: Tig[☒] Mig[☐]
Base material: Aluminium
Current: AC[☒] DC[☐]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[☐]
Penetration: pass[☒] fail[☐]

UNACCEPTABLE

Cracks: pass[☒] fail[☐]
Undercut: pass[☒] fail[☐]
Pin holes: pass[☒] fail[☐]
Overlap (cold lap): pass[☒] fail[☐]
Porosity (surface): pass[☒] fail[☐]
Coloration: pass[☒] fail[☐]

Qualifier Pat Lewis Date of Test Coupon 11.06.20
Welder Barclay Elliot Date of Test Coupon 11.06.20

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries